

Input: Colorimetric Reflective System NCS11

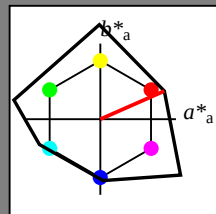
for hue $h^* = lab \cdot h = 24/360 = 0.066$

LAB*LCH, LAB*NCH

D65: hue R

LCH*Ma: 47 92 24

olv*Ma: 1.0 0.0 0.0



NCS11; adapted (a) CIELAB data

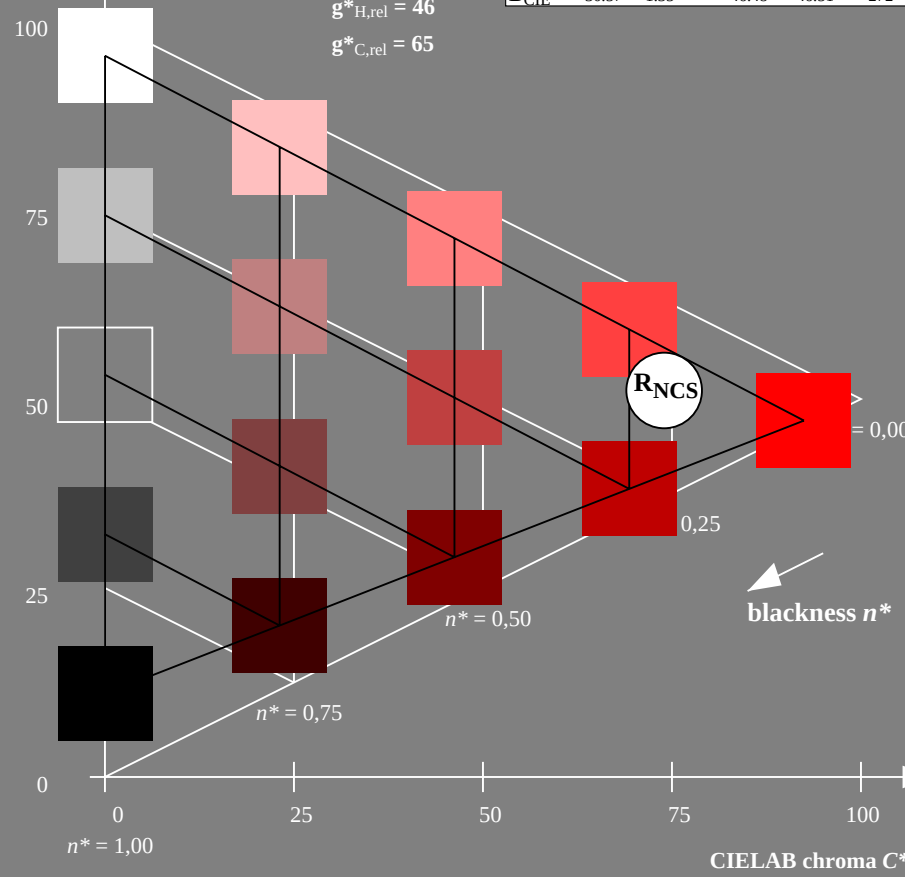
	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R_{Ma}	47.15	84.64	37.25	92.48	24
J_{Ma}	91.37	-1.27	125.03	125.03	91
G_{Ma}	63.07	-114.28	25.35	117.06	167
$G50B_{Ma}$	59.47	-80.6	-33.45	87.28	203
B_{Ma}	49.01	3.65	-81.19	81.28	273
$B50R_{Ma}$	44.06	106.09	-73.93	129.32	325
N_{Ma}	10.99	0.0	0.0	0.0	0
W_{Ma}	95.41	0.0	0.0	0.0	0
R_{CIE}	39.92	58.69	27.98	65.01	25
J_{CIE}	81.26	-2.9	71.56	71.62	92
G_{CIE}	52.23	-42.45	13.59	44.59	162
B_{CIE}	30.57	1.35	-46.48	46.51	272

CIELAB lightness L^*

%Gamut

 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

TE390-7, 5 step scales for constant CIELAB hue 24/360 = 0.066 (left)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

Output: Colorimetric Reflective System NCS11

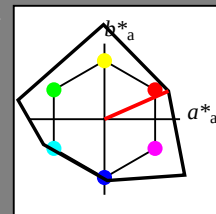
for hue $h^* = lab \cdot h = 24/360 = 0.066$

LAB*LCH, LAB*NCH

D65: hue R

LCH*Ma: 47 92 24

olv*Ma: 1.0 0.0 0.0



NCS11; adapted (a) CIELAB data

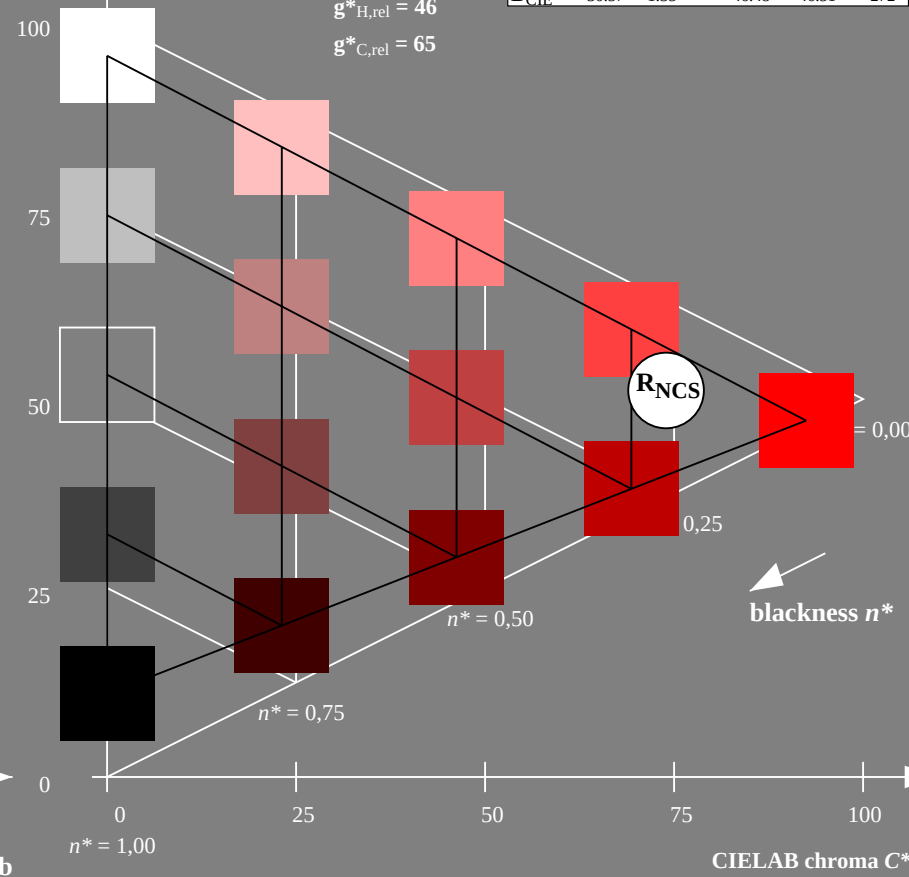
	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R_{Ma}	47.15	84.64	37.25	92.48	24
J_{Ma}	91.37	-1.27	125.03	125.03	91
G_{Ma}	63.07	-114.28	25.35	117.06	167
$G50B_{Ma}$	59.47	-80.6	-33.45	87.28	203
B_{Ma}	49.01	3.65	-81.19	81.28	273
$B50R_{Ma}$	44.06	106.09	-73.93	129.32	325
N_{Ma}	10.99	0.0	0.0	0.0	0
W_{Ma}	95.41	0.0	0.0	0.0	0
R_{CIE}	39.92	58.69	27.98	65.01	25
J_{CIE}	81.26	-2.9	71.56	71.62	92
G_{CIE}	52.23	-42.45	13.59	44.59	162
B_{CIE}	30.57	1.35	-46.48	46.51	272

CIELAB lightness L^*

%Gamut

 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

5 step scales for constant CIELAB hue 24/360 = 0.066 (right)

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

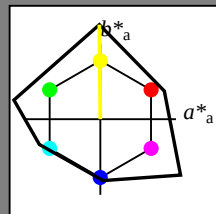
for hue $h^* = lab^*h = 91/360 = 0.252$

LAB*LCH, LAB*NCH

D65: hue J

LCH*Ma: 91 125 91

olv*Ma: 1.0 1.0 0.0

CIELAB lightness L^*

%Gamut

 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272

Output: Colorimetric Reflective System NCS11

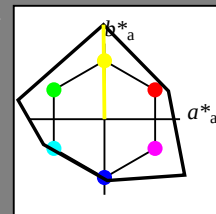
for hue $h^* = lab^*h = 91/360 = 0.252$

LAB*LCH, LAB*NCH

D65: hue J

LCH*Ma: 91 125 91

olv*Ma: 1.0 1.0 0.0

CIELAB lightness L^*

%Gamut

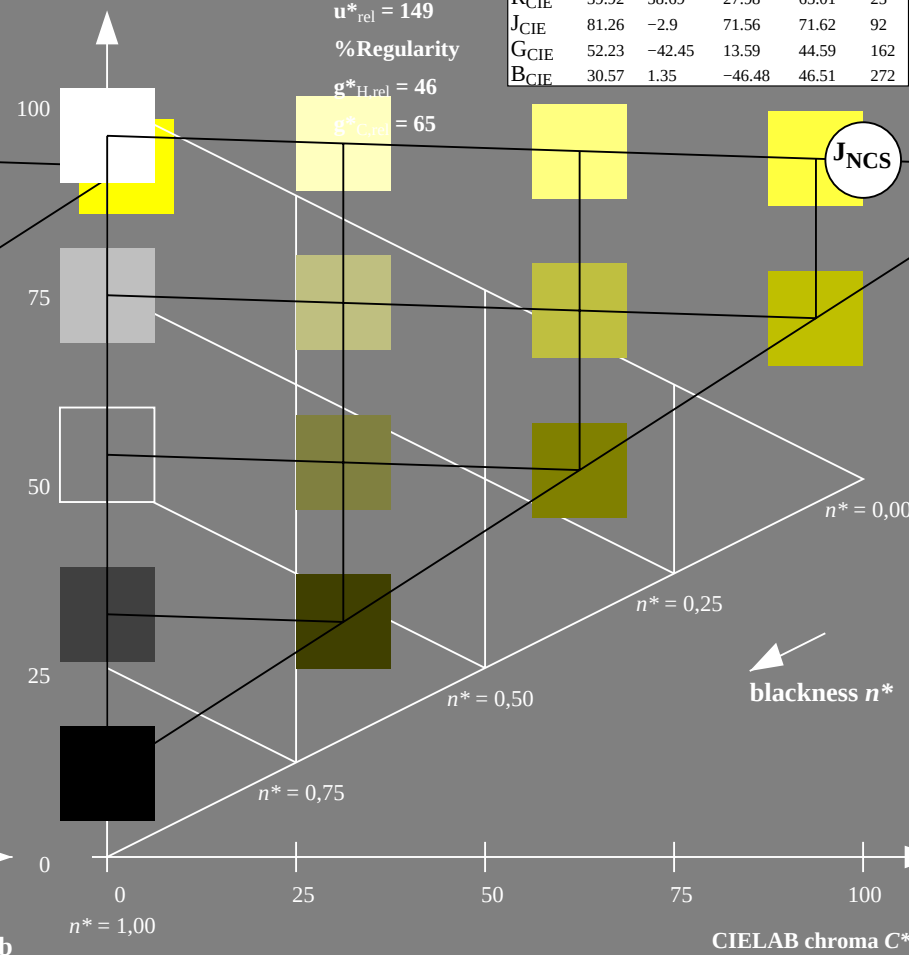
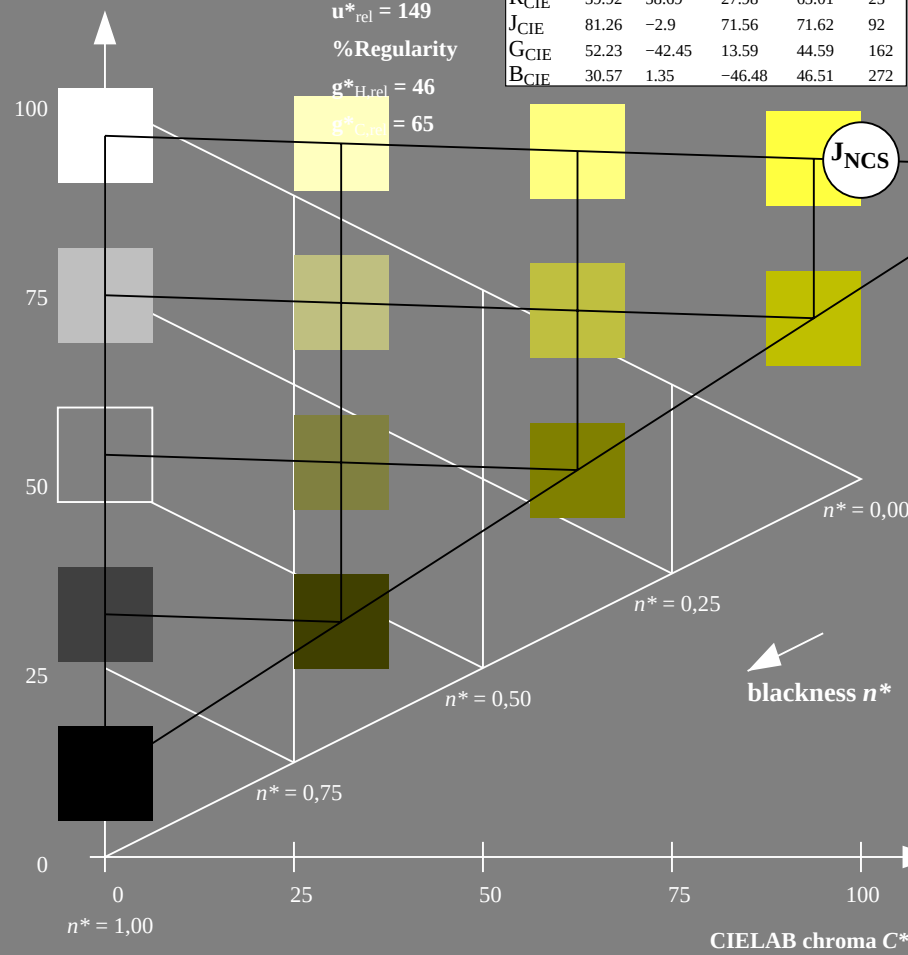
 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIELAB hue 91/360 = 0.252 (left)

5 step scales for constant CIELAB hue 91/360 = 0.252 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 167/360 = 0.465$

LAB*LCH, LAB*NCH

D65: hue G

LCH*Ma: 63 117 167

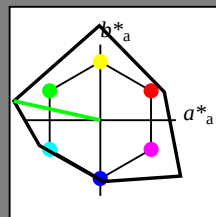
olv*Ma: 0.0 1.0 0.0

CIE LAB lightness L^*

% Gamut

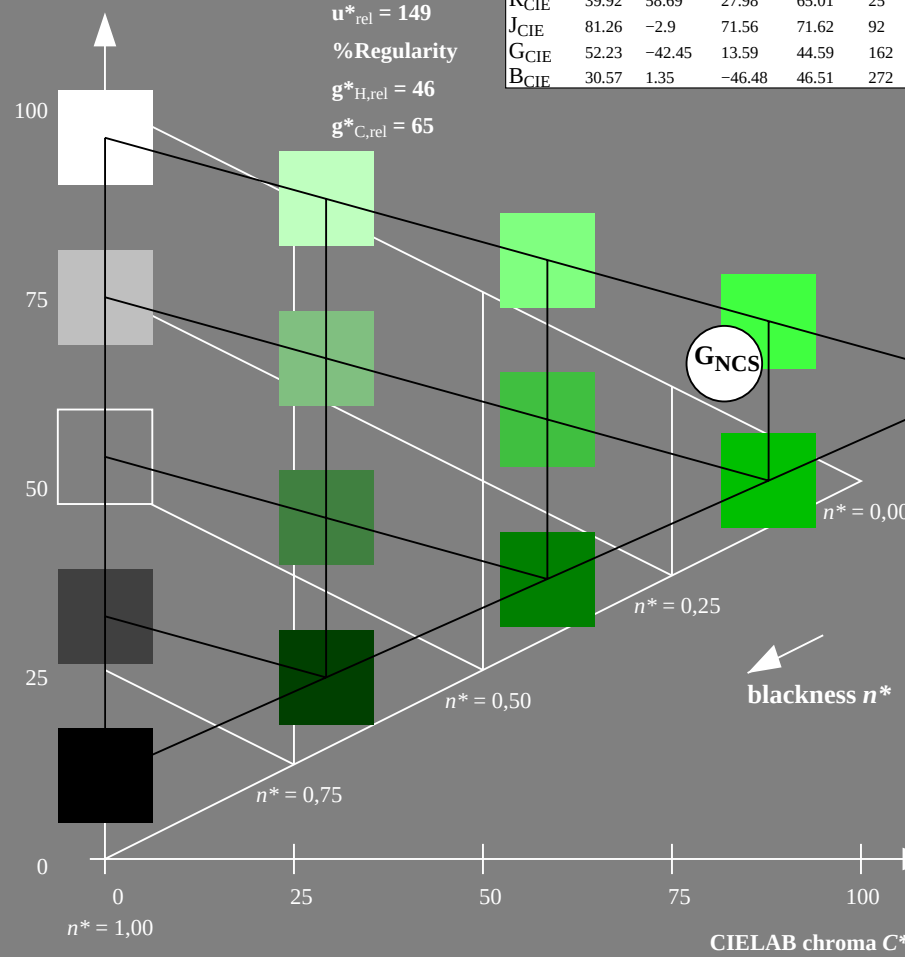
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIE LAB hue 167/360 = 0.465 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 167/360 = 0.465$

LAB*LCH, LAB*NCH

D65: hue G

LCH*Ma: 63 117 167

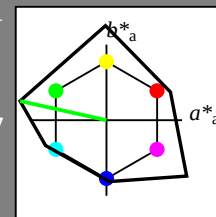
olv*Ma: 0.0 1.0 0.0

CIE LAB lightness L^*

% Gamut

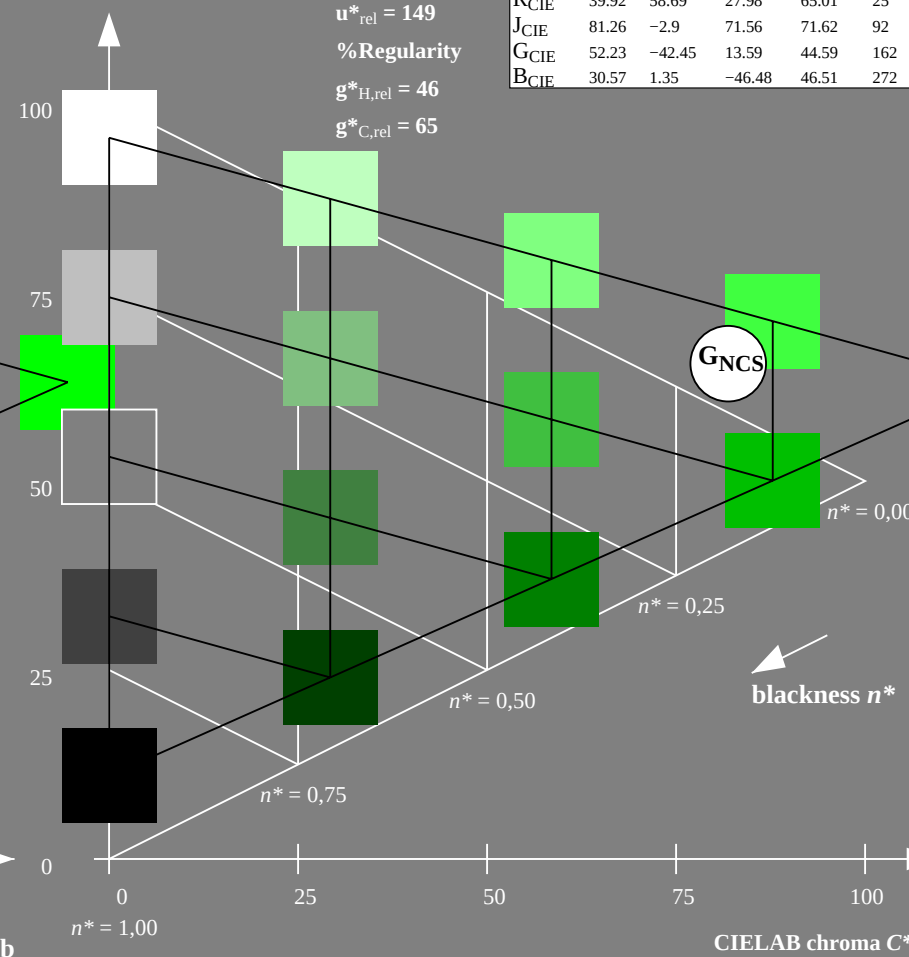
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



5 step scales for constant CIE LAB hue 167/360 = 0.465 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

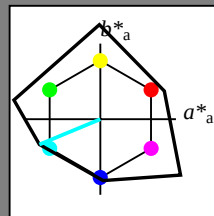
for hue $h^* = lab \cdot h = 203/360 = 0.563$

LAB*LCH, LAB*NCH

D65: hue G50B

LCH*Ma: 59 87 203

olv*Ma: 0.0 1.0 1.0

CIELAB lightness L^*

%Gamut

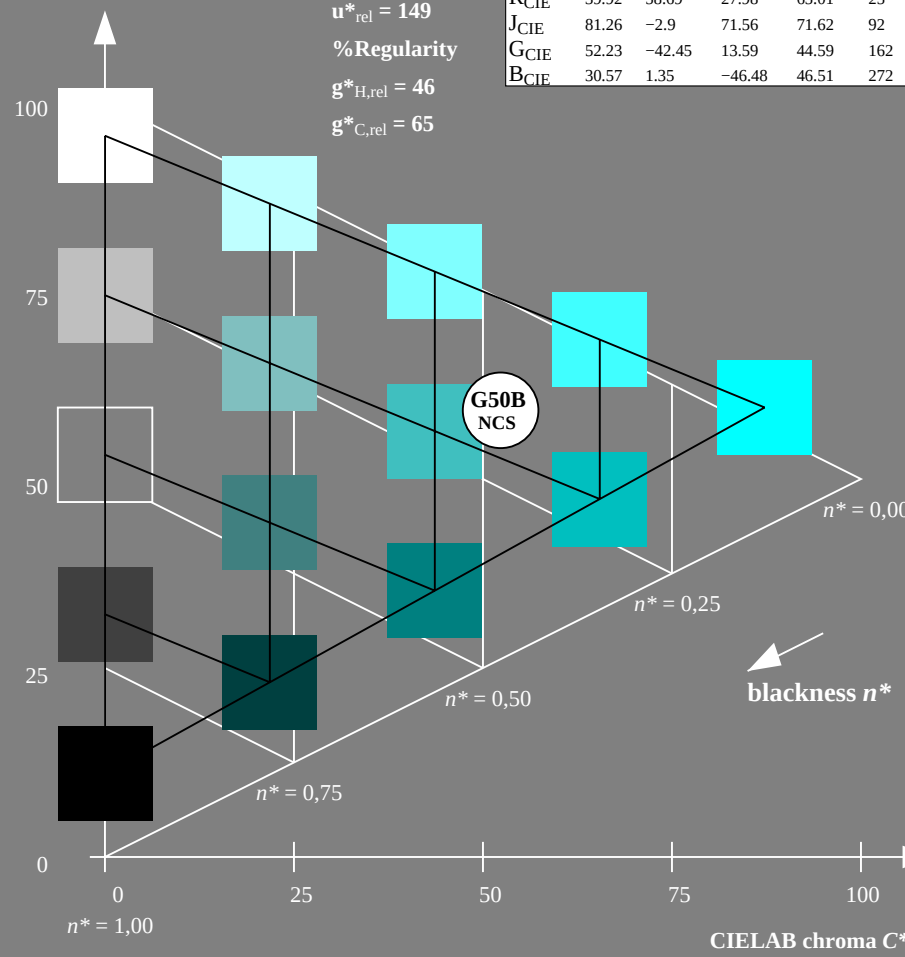
 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIELAB hue 203/360 = 0.563 (left)

Output: Colorimetric Reflective System NCS11

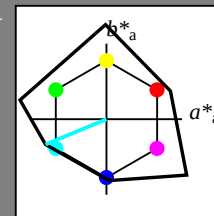
for hue $h^* = lab \cdot h = 203/360 = 0.563$

LAB*LCH, LAB*NCH

D65: hue G50B

LCH*Ma: 59 87 203

olv*Ma: 0.0 1.0 1.0

CIELAB lightness L^*

%Gamut

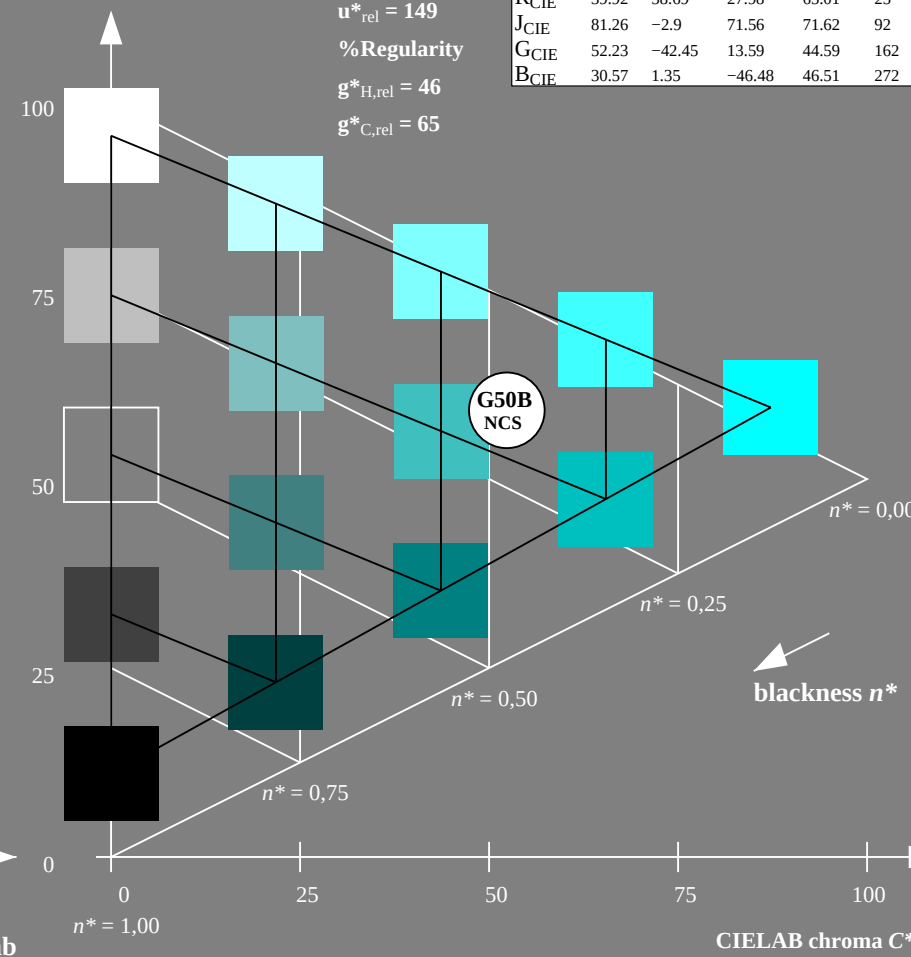
 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



5 step scales for constant CIELAB hue 203/360 = 0.563 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

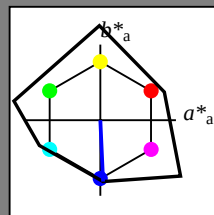
for hue $h^* = lab^*h = 273/360 = 0.757$

LAB*LCH, LAB*NCH

D65: hue B

LCH*Ma: 49 81 273

olv*Ma: 0.0 0.0 1.0

CIELAB lightness L^*

%Gamut

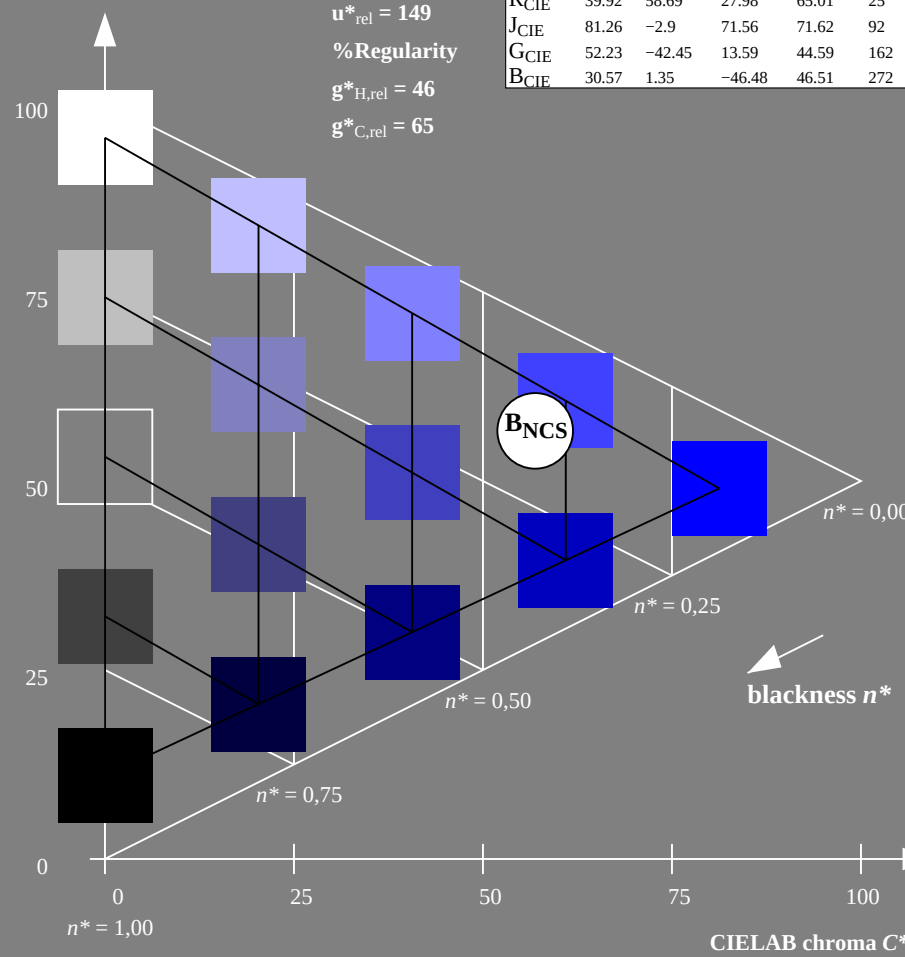
 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIELAB hue 273/360 = 0.757 (left)



BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

Output: Colorimetric Reflective System NCS11

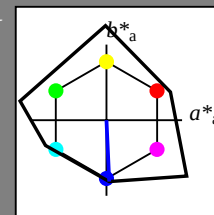
for hue $h^* = lab^*h = 273/360 = 0.757$

LAB*LCH, LAB*NCH

D65: hue B

LCH*Ma: 49 81 273

olv*Ma: 0.0 0.0 1.0

CIELAB lightness L^*

%Gamut

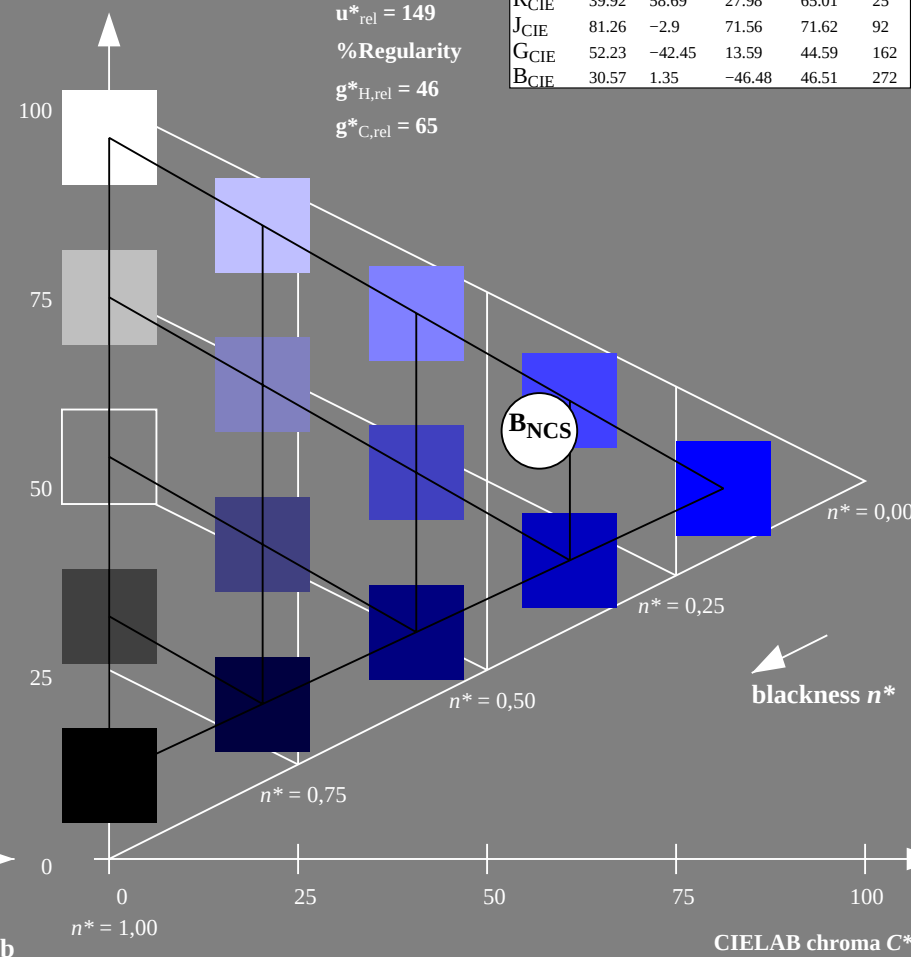
 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



5 step scales for constant CIELAB hue 273/360 = 0.757 (right)

input: olv* setrgbcolor

output: Startup (S) data dependend



Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 325/360 = 0.903$

LAB*LCH, LAB*NCH

D65: hue B50R

LCH*Ma: 44 129 325

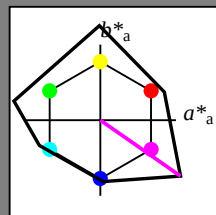
olv*Ma: 1.0 0.0 1.0

CIELAB lightness L^*

% Gamut

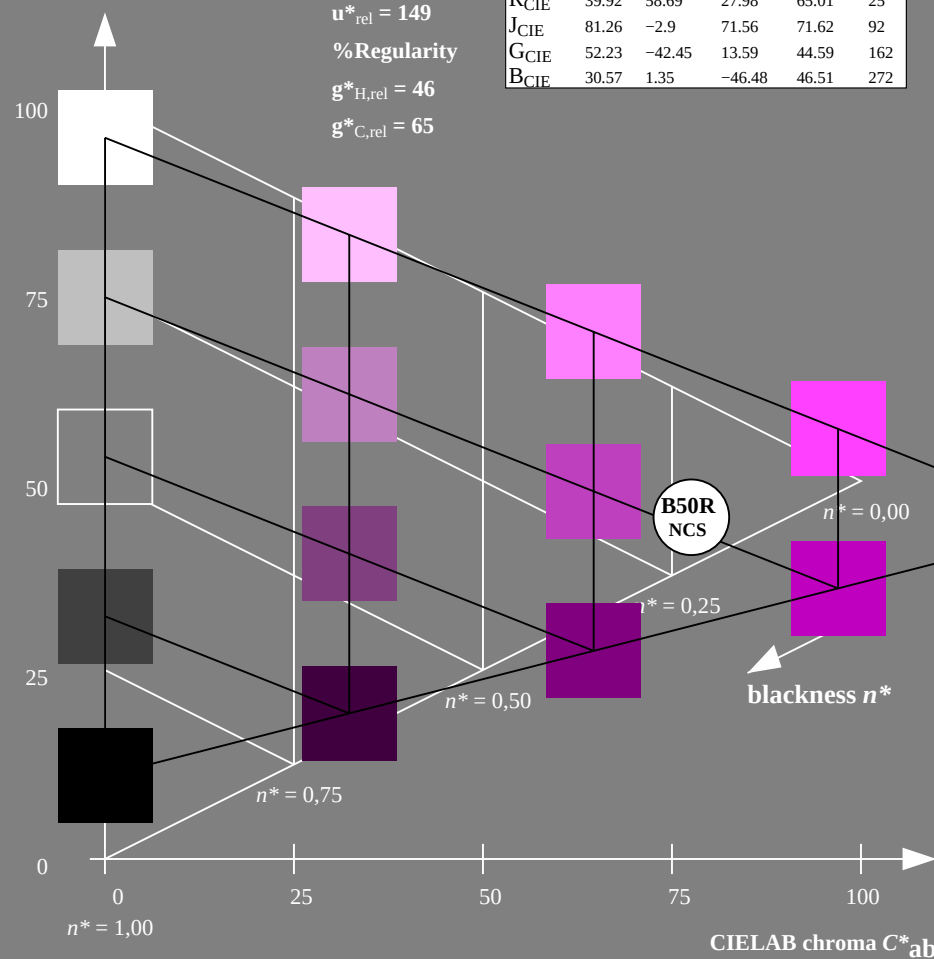
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIELAB hue 325/360 = 0.903 (left)



BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 325/360 = 0.903$

LAB*LCH, LAB*NCH

D65: hue B50R

LCH*Ma: 44 129 325

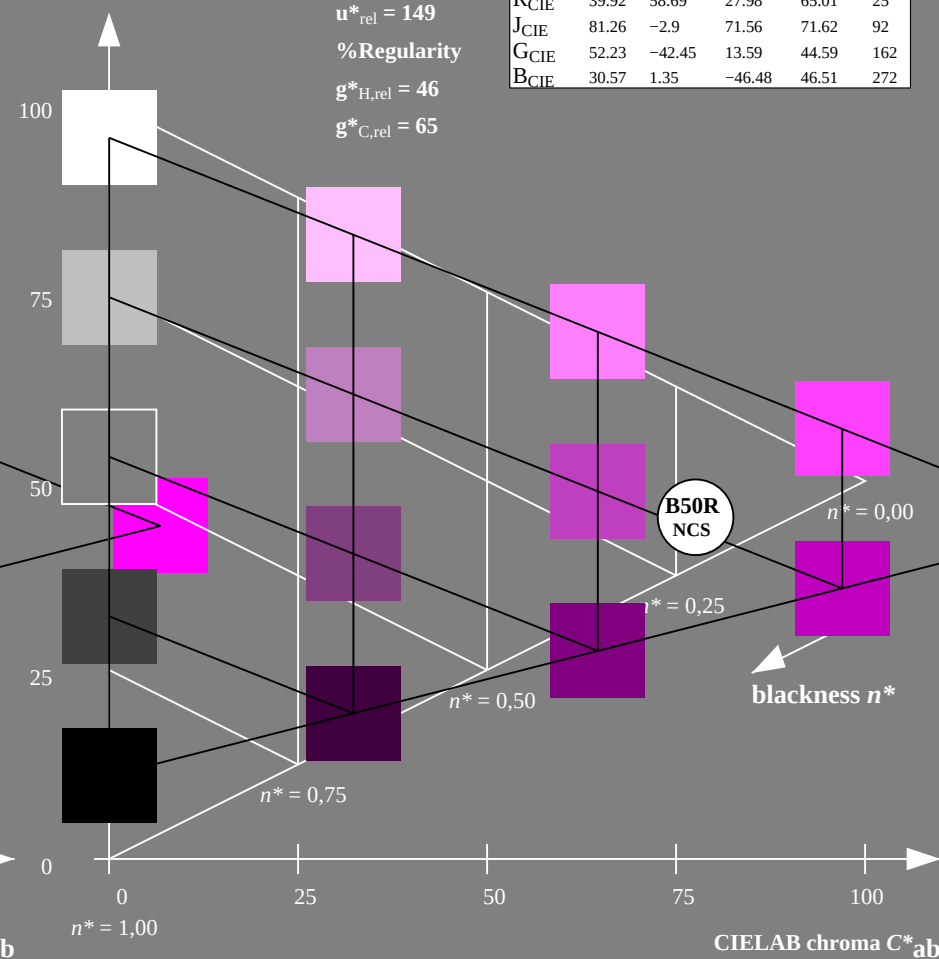
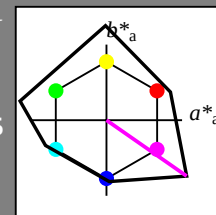
olv*Ma: 1.0 0.0 1.0

CIELAB lightness L^*

% Gamut

 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

5 step scales for constant CIELAB hue 325/360 = 0.903 (right)

input: olv* setrgbcolor

output: Startup (S) data dependend



Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 25/360 = 0.071$

LAB*LCH, LAB*NCH

D65: hue R

LCH*Ma: 48 91 25

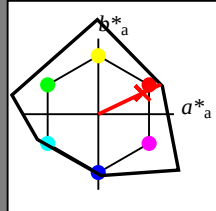
olv*Ma: 1.0 0.02 0.0

CIE LAB lightness L^*

% Gamut

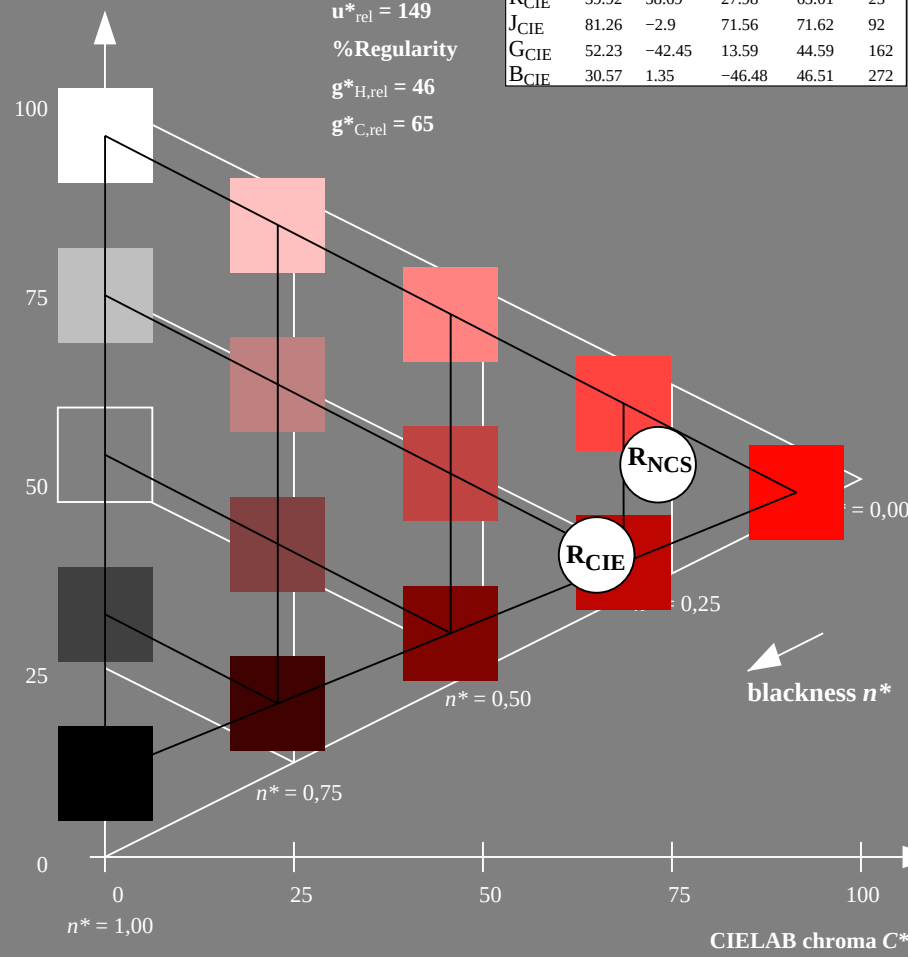
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIE LAB hue 25/360 = 0.071 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 25/360 = 0.071$

LAB*LCH, LAB*NCH

D65: hue R

LCH*Ma: 48 91 25

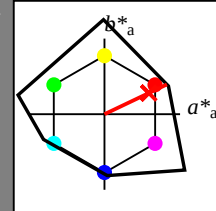
olv*Ma: 1.0 0.02 0.0

CIE LAB lightness L^*

% Gamut

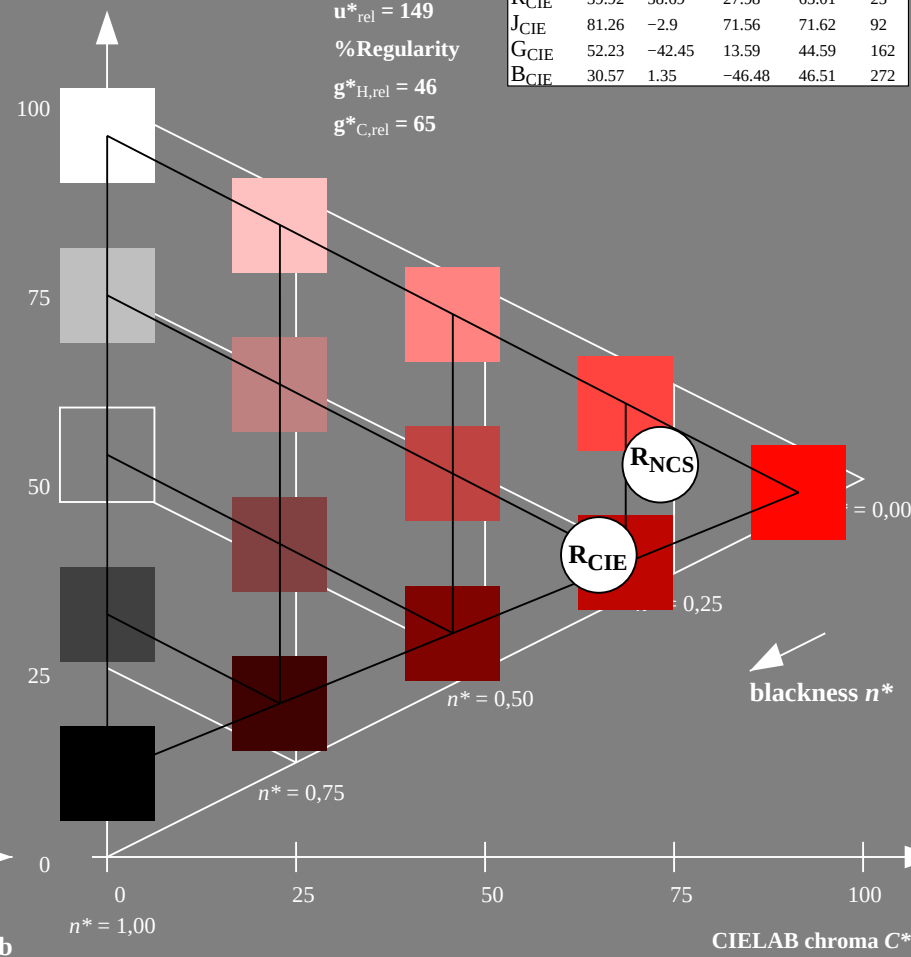
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



5 step scales for constant CIE LAB hue 25/360 = 0.071 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab^*h = 92/360 = 0.256$

LAB*LCH, LAB*NCH

D65: hue J

LCH*Ma: 90 122 92

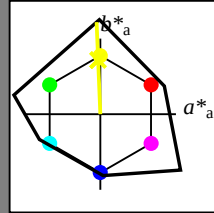
olv*Ma: 0.97 1.0 0.0

CIELAB lightness L^*

%Gamut

 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab^*h = 92/360 = 0.256$

LAB*LCH, LAB*NCH

D65: hue J

LCH*Ma: 90 122 92

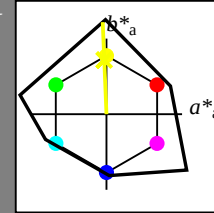
olv*Ma: 0.97 1.0 0.0

CIELAB lightness L^*

%Gamut

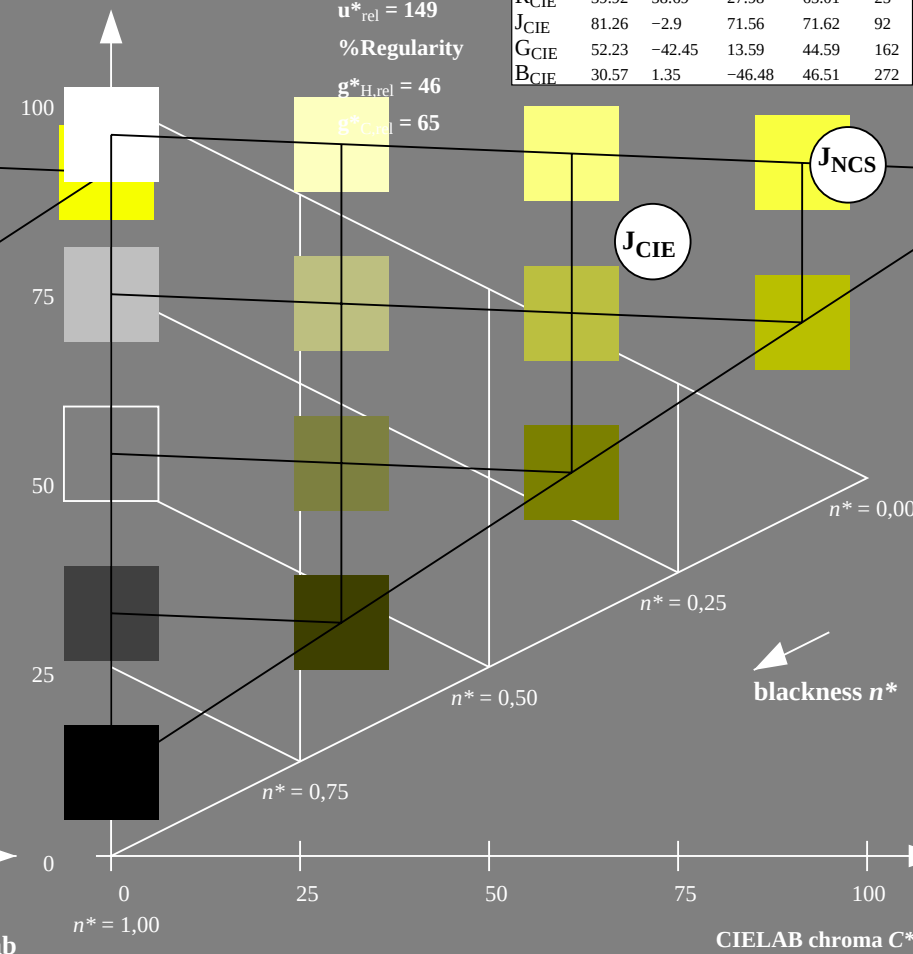
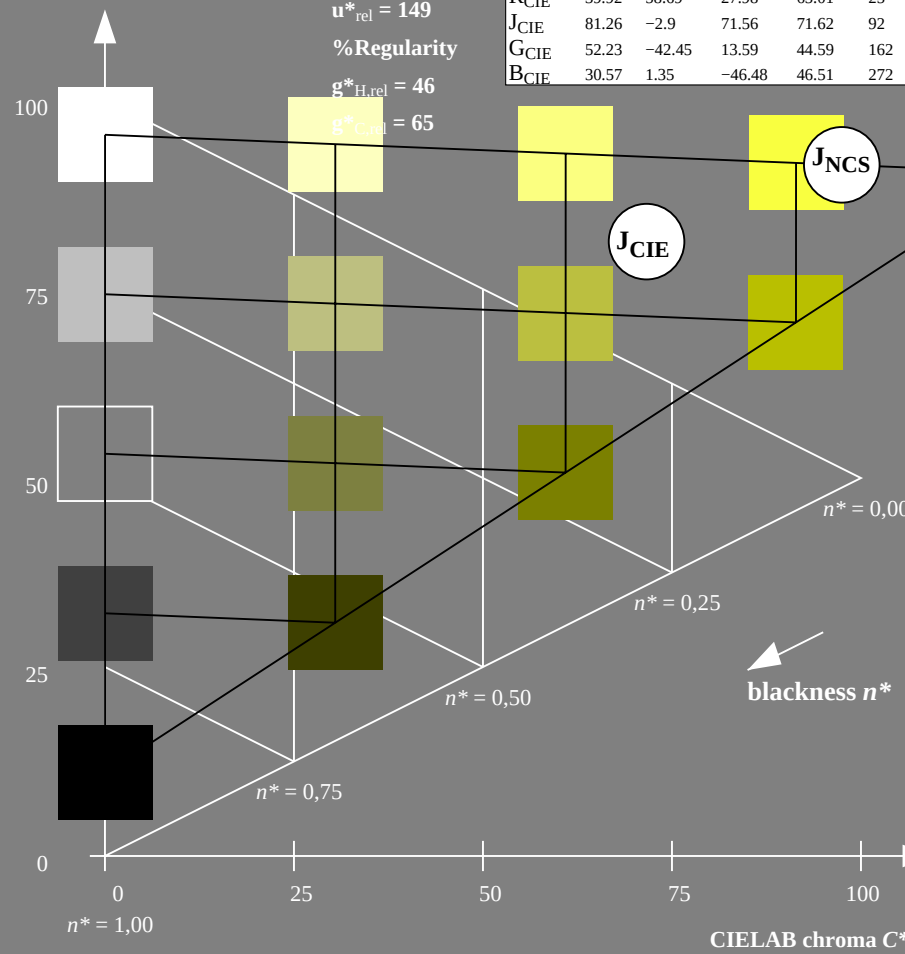
 $u^*_{rel} = 149$

%Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIELAB hue 92/360 = 0.256 (left)

5 step scales for constant CIELAB hue 92/360 = 0.256 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 162/360 = 0.451$

LAB*LCH, LAB*NCH

D65: hue G

LCH*Ma: 65 110 162

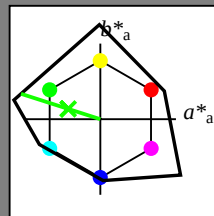
olv*Ma: 0.08 1.0 0.0

CIE LAB lightness L^*

% Gamut

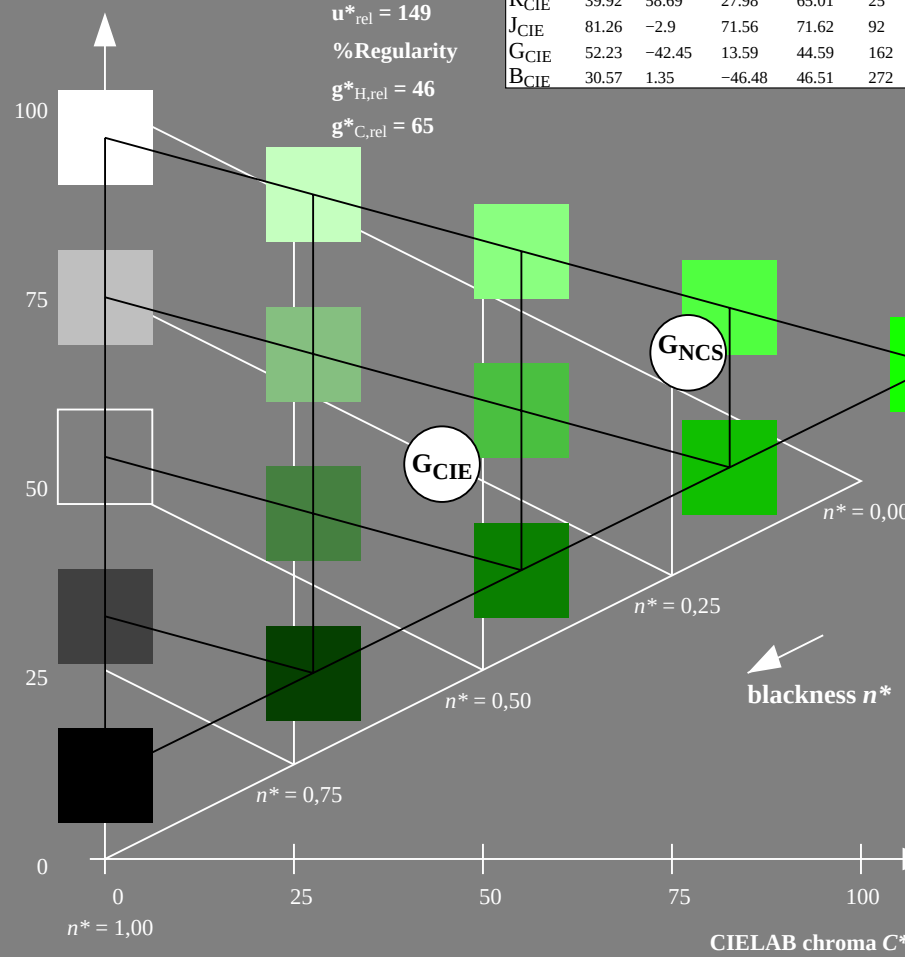
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R_{Ma}	47.15	84.64	37.25	92.48	24
J_{Ma}	91.37	-1.27	125.03	125.03	91
G_{Ma}	63.07	-114.28	25.35	117.06	167
$G50B_{Ma}$	59.47	-80.6	-33.45	87.28	203
B_{Ma}	49.01	3.65	-81.19	81.28	273
$B50R_{Ma}$	44.06	106.09	-73.93	129.32	325
N_{Ma}	10.99	0.0	0.0	0.0	0
W_{Ma}	95.41	0.0	0.0	0.0	0
R_{CIE}	39.92	58.69	27.98	65.01	25
J_{CIE}	81.26	-2.9	71.56	71.62	92
G_{CIE}	52.23	-42.45	13.59	44.59	162
B_{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIE LAB hue 162/360 = 0.451 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 162/360 = 0.451$

LAB*LCH, LAB*NCH

D65: hue G

LCH*Ma: 65 110 162

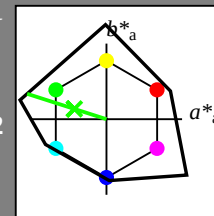
olv*Ma: 0.08 1.0 0.0

CIE LAB lightness L^*

% Gamut

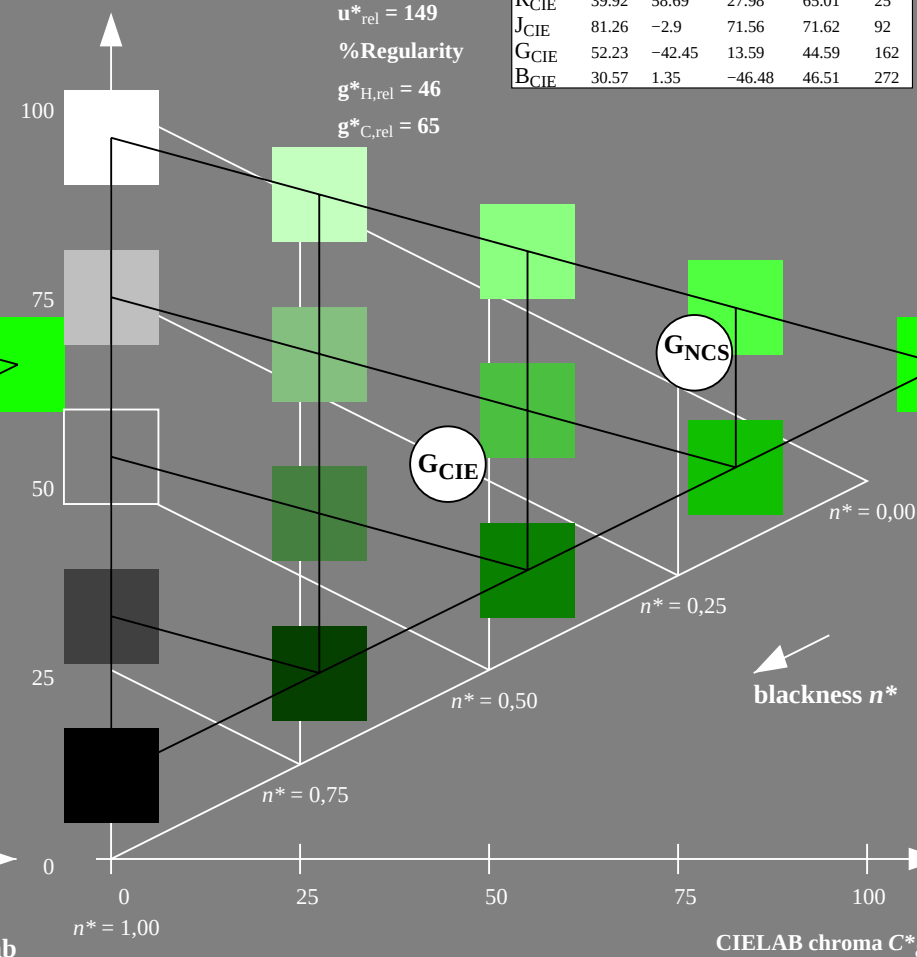
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R_{Ma}	47.15	84.64	37.25	92.48	24
J_{Ma}	91.37	-1.27	125.03	125.03	91
G_{Ma}	63.07	-114.28	25.35	117.06	167
$G50B_{Ma}$	59.47	-80.6	-33.45	87.28	203
B_{Ma}	49.01	3.65	-81.19	81.28	273
$B50R_{Ma}$	44.06	106.09	-73.93	129.32	325
N_{Ma}	10.99	0.0	0.0	0.0	0
W_{Ma}	95.41	0.0	0.0	0.0	0
R_{CIE}	39.92	58.69	27.98	65.01	25
J_{CIE}	81.26	-2.9	71.56	71.62	92
G_{CIE}	52.23	-42.45	13.59	44.59	162
B_{CIE}	30.57	1.35	-46.48	46.51	272



5 step scales for constant CIE LAB hue 162/360 = 0.451 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab^*h = 272/360 = 0.755$

LAB*LCH, LAB*NCH

D65: hue B

LCH*Ma: 49 80 272

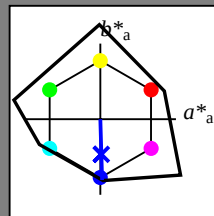
olv*Ma: 0.0 0.02 1.0

CIE LAB lightness L^*

% Gamut

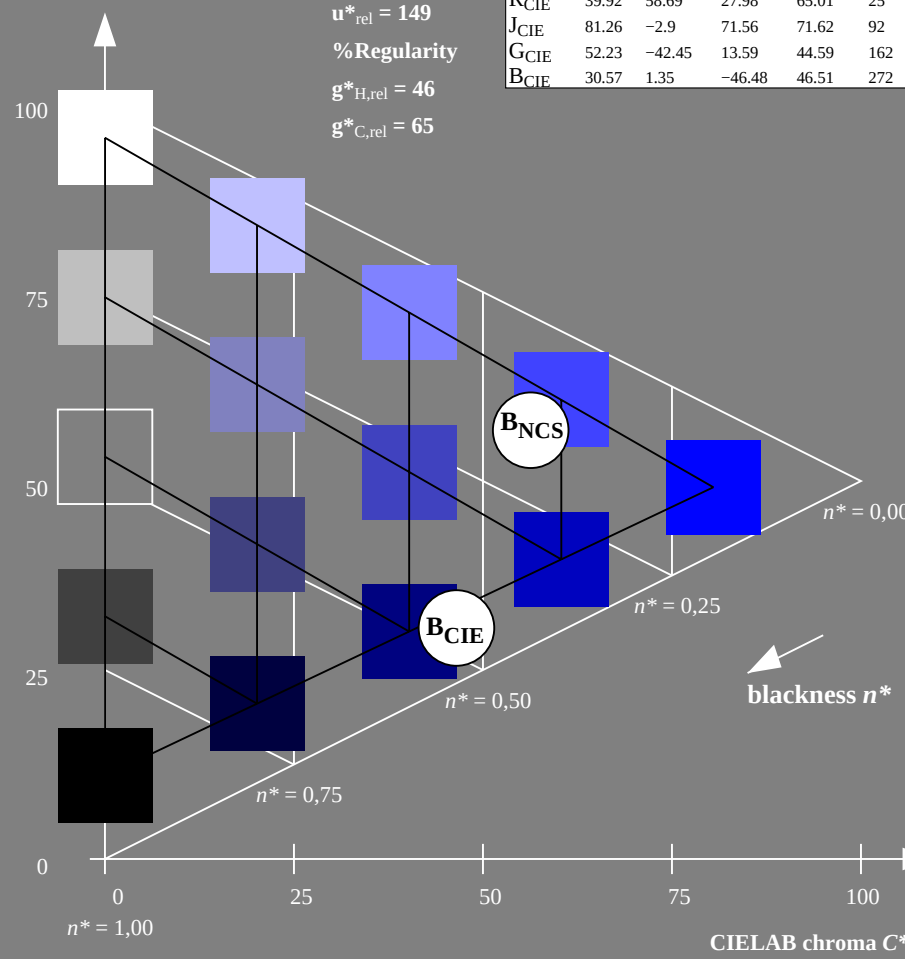
 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

NCS11; adapted (a) CIE LAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
R _{Ma}	47.15	84.64	37.25	92.48	24
J _{Ma}	91.37	-1.27	125.03	125.03	91
G _{Ma}	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272



TE390-7, 5 step scales for constant CIE LAB hue 272/360 = 0.755 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab^*h = 272/360 = 0.755$

LAB*LCH, LAB*NCH

D65: hue B

LCH*Ma: 49 80 272

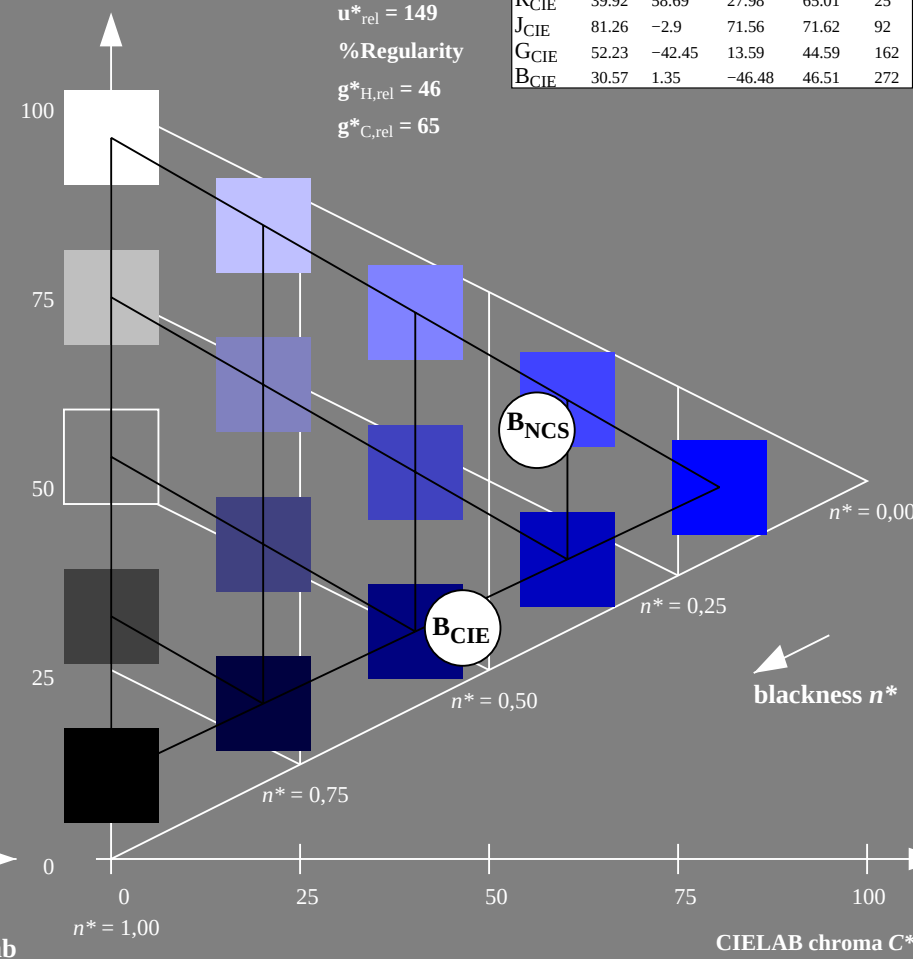
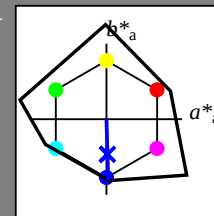
olv*Ma: 0.0 0.02 1.0

CIE LAB lightness L^*

% Gamut

 $u^*_{rel} = 149$

% Regularity

 $g^*_{H,rel} = 46$ $g^*_{C,rel} = 65$ 

5 step scales for constant CIE LAB hue 272/360 = 0.755 (right)

BAM-test chart TE39; Colorimetric systems ORS18 & ORS18

D65: Coordinate systems of 5 step colour scales for 10 hues

input: olv* setrgbcolor

output: Startup (S) data dependend