

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, D65$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,3190$$

$$y_{17M1E,D}=0,3333; 0,3324$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 104,84$$

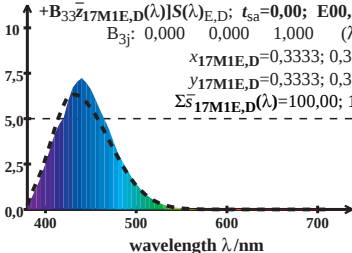

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, D50$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,3424$$

$$y_{17M1E,D}=0,3333; 0,3650$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 80,14$$

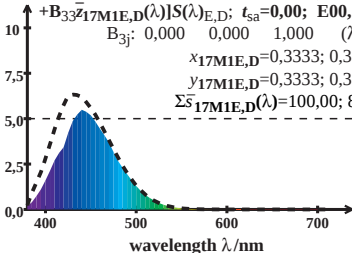

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, P40$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,3679$$

$$y_{17M1E,D}=0,3333; 0,3830$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 64,99$$

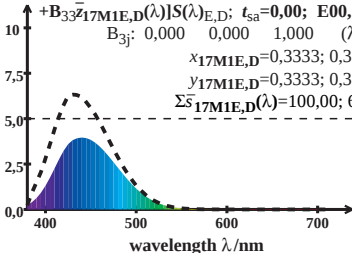

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, A00$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,4207$$

$$y_{17M1E,D}=0,3333; 0,4225$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 37,07$$

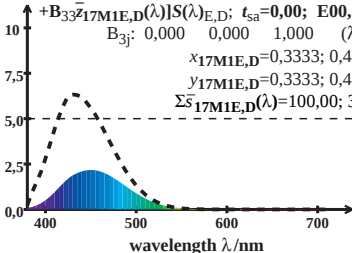

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, E00$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,3333$$

$$y_{17M1E,D}=0,3333; 0,3333$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 99,99$$

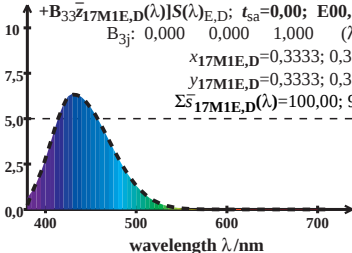

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, C00$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,3188$$

$$y_{17M1E,D}=0,3333; 0,3220$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 111,48$$

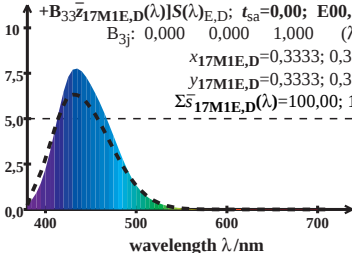

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda)=[B_{31}\bar{x}_{17M1E,D}(\lambda)+B_{32}\bar{y}_{17M1E,D}(\lambda)$$


$$+B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; t_{sa}=0,00; E00, P00$$

$$B_{3j}: 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; 0,3530$$

$$y_{17M1E,D}=0,3333; 0,3561$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda)=100,00; 81,63$$

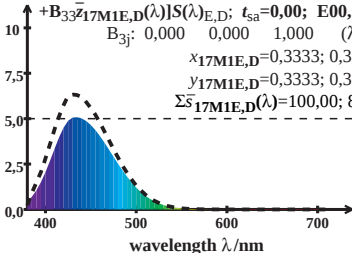

LMS_17M1 cone sensitivity; $Y_w=100$

$$\bar{s}_{17M1E,D}(\lambda) = [B_{31}\bar{x}_{17M1E,D}(\lambda) + B_{32}\bar{y}_{17M1E,D}(\lambda) + B_{33}\bar{z}_{17M1E,D}(\lambda)]S(\lambda)_{E,D}; \quad t_{sa}=0,00; \quad E00, Q00$$

$$B_{3j}: \quad 0,000 \quad 0,000 \quad 1,000 \quad (\lambda=440)$$

$$x_{17M1E,D}=0,3333; \quad 0,3163$$

$$y_{17M1E,D}=0,3333; \quad 0,3135$$

$$\Sigma \bar{s}_{17M1E,D}(\lambda) = 100,00; \quad 118,04$$

