


CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda) + A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$\text{D65: } \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 107,23$$

$$x_{\text{F10_X,s}} = 0,3137 \quad y_{\text{F10_X,s}} = 0,3311$$

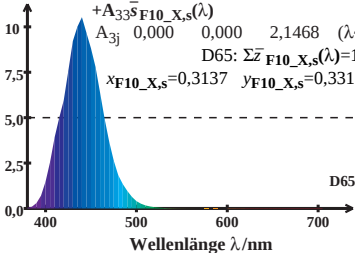


CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda) + A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$\text{D50: } \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 81,30$$

$$x_{\text{F10_X,s}} = 0,3481 \quad y_{\text{F10_X,s}} = 0,3595$$

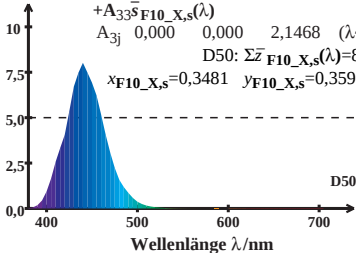


CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda) + A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$\text{P40: } \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 64,39$$

$$x_{\text{F10_X,s}} = 0,3829 \quad y_{\text{F10_X,s}} = 0,3753$$

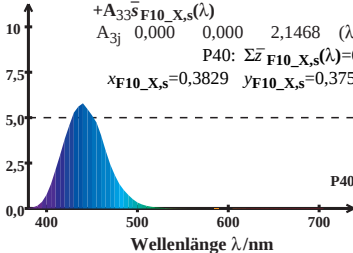


CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda) + A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$A_{00}: \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 35,02$$

$$x_{\text{F10_X,s}} = 0,4528 \quad y_{\text{F10_X,s}} = 0,4051$$

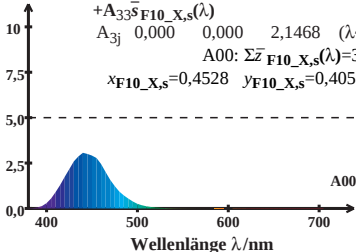


CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda) + A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$E00: \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 100,12$$

$$x_{\text{F10_X,s}} = 0,3332 \quad y_{\text{F10_X,s}} = 0,3331$$

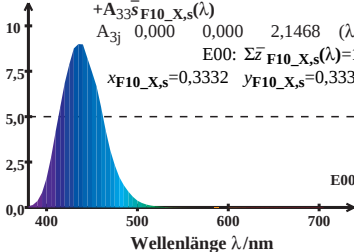

CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$


$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda)$$

$$+ A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$\text{C00: } \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 116,17$$

$$x_{\text{F10_X,s}} = 0,3101 \quad y_{\text{F10_X,s}} = 0,3191$$

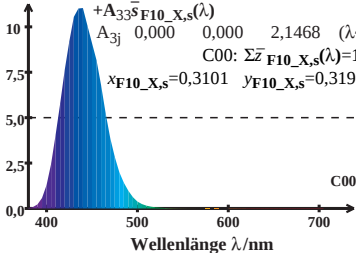


CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31} \bar{l}_{\text{F10_X,s}}(\lambda) + A_{32} \bar{m}_{\text{F10_X,s}}(\lambda) + A_{33} \bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$P00: \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 81,34$$

$$x_{\text{F10_X,s}} = 0,3612 \quad y_{\text{F10_X,s}} = 0,3522$$

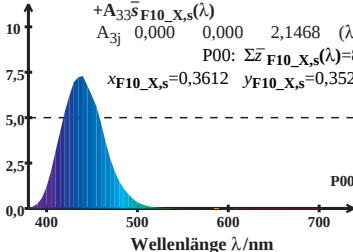

CIEF10_X-Normspektralwerte $Y_{\text{sum}}=100$

$$\bar{z}_{\text{F10_X,s}}(\lambda) = A_{31}\bar{l}_{\text{F10_X,s}}(\lambda) + A_{32}\bar{m}_{\text{F10_X,s}}(\lambda) + A_{33}\bar{s}_{\text{F10_X,s}}(\lambda)$$

$$A_{3j} \quad 0,000 \quad 0,000 \quad 2,1468 \quad (\lambda \sim 445)$$

$$Q00: \Sigma \bar{z}_{\text{F10_X,s}}(\lambda) = 122,64$$

$$x_{\text{F10_X,s}} = 0,3062 \quad y_{\text{F10_X,s}} = 0,3115$$

